



G&L Consultancy Ltd

Specialists in Asbestos Management

REASSURANCE			
Certificate Reference Number:	J019462/AC02	Client Order No. (if applicable)	N/A
Sampling Date:	18 Nov 2012	Project: (if applicable)	
Client Name and Address:	Abbey Contracting Ltd, Unit 8 & 9, Wirral Park, Glastonbury, Somerset, BA6 9XE		
Site Address:	Regal Theatre, The Avenue, Minehead, Somerset		
Location of work area:	Main Theatre Stairwell		
Removal Contractor Name and Address:	Abbey Contracting Ltd, Unit 8 & 9, Wirral Park, Glastonbury, Somerset, BA6 9XE		
Inspecting/Sampling Officer:	Jason Monger		
Fibre Counting Analyst:	Jason Monger	Time Arrived on site:	10:00
Reason for Sampling:	Reassurance tests following removal of Asbestos Textured Coating Wall damage containing Chrysotile (white asbestos)		

Sampling carried out by our own officers follows the procedures documented in our internal method M4 – The Sampling of Air, by Personal and Static Means, for Analysis to Determine the Airborne Asbestos Fibre Concentrations. Analysis has been carried out in accordance with our internal method M1 – The Measurement of Asbestos Fibre Concentrations, in Air, by Light Microscopy. Both these internal methods follow the standard methods as outlined in the HSE Literature 'Asbestos: The analysts' guide for sampling, analysis and clearance procedures.' Any deviations from these standard methods are detailed above. No responsibility is taken for sampling that is not carried out by our own officers. Opinions and interpretations expressed herein are outside the scope of our UKAS accreditation. G & L Consultancy Ltd does not accept any responsibility for any stages of the Certificate of Reoccupation that have not been carried out by persons directly employed by G & L Consultancy Ltd. This test report shall not be reproduced, except in full, without the written permission of the laboratory.



G&L Consultancy Ltd

Unit 5A, Chelston Business Park, Castle Road, Wellington, Somerset TA21 9JQ

T 01823 443 898 F 01823 443 154 E somerset@gnl.org.uk W www.gnl.org.uk

Registered Office: Unit 5A, Chelston Business Park, Castle Road, Wellington, Somerset TA21 9JQ

G&L Consultancy Ltd is a company registered in England and Wales with a Company Number: 3687929

Company Directors: Mrs J Lewis and Mr P Lewis. VAT Registration Number: 729 1092 34



AIR MONITORING											
Site Ref No	Laboratory Reference No	Pump No	Sampling Period		Flow Rate		Volume (litres) (V)	No of Graticule areas (n)	Fibres (N)	Concentration Fibres/ml	Reported Result fibres/ml
			Start End	Total Mins	Start End	Total (L/min)					
1	AC000529	C103	10:30	82	10.0	10.0	820	117	2.5	0.001	<0.01
			11:52		10.0						
Site Temp:			14.9°C			Analysis Location:			Mobile Lab		
Site Pressure:			N/A			Exposed Filter Diameter (D):			22.0mm		
Flowmeter Correction Factor:			N/A			Walton Beckett Graticule (d):			101µm		
Slides Stored In Slide Box No:			JSM1			5th Line Of NSE/NPL Test Slide Observed:			YES		
Comments: N/A											

Site Ref No	Sampling Locations
1	Underneath damaged TC

VISUAL INSPECTION

Visual Inspection Carried out:

YES - see below for full details of the extent of the area inspected and findings


Visual inspection carried out on small area on wall where TC has been damaged, scaped away to brickwork. Flooring underneath has been sheeted.

Result of Air Monitoring: SATISFACTORY

Analyst:

Jason Monger


Signed:



Date: 18 Nov 2012

Time: 11:58


Report received by Site Supervisor:



Print name: Nathan Walford

REASSURANCE PLAN

Site Address:	Regal Theatre, The Avenue, Minehead, Somerset
Location of work area:	Main Theatre Stairwell
Sampling Date:	18 Nov 2012

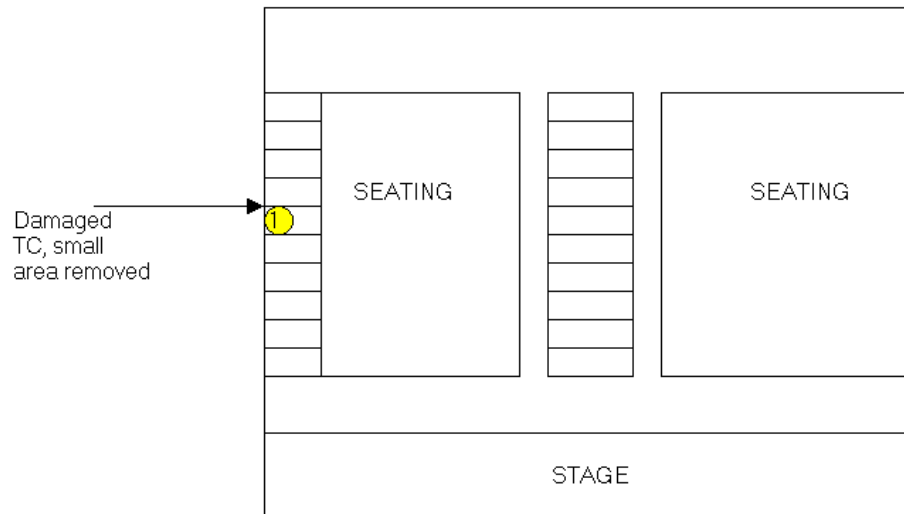

This plan is not to scale.